

OPERATOR'S MANUAL



TUBE AND PIPE NOTCHER MODEL: TN-300

Baileigh Industrial Holdings LLC P.O. Box 531 Manitowoc, WI 54221-0531 Phone: 920.684.4990

Fax: 920.684.3944 sales@baileigh.com

REPRODUCTION OF THIS MANUAL IN ANY FORM WITHOUT WRITTEN APPROVAL OF BAILEIGH INDUSTRIAL HOLDINGS LLC IS PROHIBITED. Baileigh Industrial Holdings LLC, Inc. does not assume and hereby disclaims any liability for any damage or loss caused by an omission or error in this Operator's Manual, resulting from accident, negligence, or other occurrence.

Rev. 09/2019



Table of Contents

THANK YOU & WARRANTY	1
INTRODUCTION	3
GENERAL NOTES	3
SAFETY INSTRUCTIONS	4
SAFETY PRECAUTIONS	6
Dear Valued Customer:	6
TECHNICAL SPECIFICATIONS	8
TECHNICAL SUPPORT	8
UNPACKING AND CHECKING CONTENTS	9
TRANSPORTING AND LIFTING	10
INSTALLATION	11
Anchoring the Machine	11
OVERALL DIMENSIONS	12
ELECTRICAL	13
OPERATION	15
Arbor Adapters	16
MACHINE ADJUSTMENTS	17
LUBRICATION AND MAINTENANCE	17
PARTS DIAGRAM	18
Handwheel Assembly Parts Diagram	18
Main Tube Assembly Parts Diagram	19
Roller Base Assembly Parts Diagram	20
Lock Nut Assembly Parts Diagram	21
Vise Assembly Parts Diagram	22
Electrical Box Assembly Parts Diagram	23
Parts List	
ELECTRICAL SCHEMATIC	27



THANK YOU & WARRANTY

Thank you for your purchase of a machine from Baileigh Industrial Holdings LLC. We hope that you find it productive and useful to you for a long time to come.

Inspection & Acceptance. Buyer shall inspect all Goods within ten (10) days after receipt thereof. Buyer's payment shall constitute final acceptance of the Goods and shall act as a waiver of the Buyer's rights to inspect or reject the goods unless otherwise agreed. If Buyer rejects any merchandise, Buyer must first obtain a Returned Goods Authorization ("RGA") number before returning any goods to Seller. Goods returned without an RGA will be refused. Seller will not be responsible for any freight costs, damages to goods, or any other costs or liabilities pertaining to goods returned without a RGA. Seller shall have the right to substitute a conforming tender. Buyer will be responsible for all freight costs to and from Buyer and repackaging costs, if any, if Buyer refuses to accept shipment. If Goods are returned in unsalable condition, Buyer shall be responsible for full value of the Goods. Buyer may not return any special-order Goods. Any Goods returned hereunder shall be subject to a restocking fee equal to 30% of the invoice price.

Specifications. Seller may, at its option, make changes in the designs, specifications or components of the Goods to improve the safety of such Goods, or if in Seller's judgment, such changes will be beneficial to their operation or use. Buyer may not make any changes in the specifications for the Goods unless Seller approves of such changes in writing, in which event Seller may impose additional charges to implement such changes.

Limited Warranty. Seller warrants to the original end-user that the Goods manufactured or provided by Seller under this Agreement shall be free of defects in material or workmanship for a period of twelve (12) months from the date of purchase, provided that the Goods are installed, used, and maintained in accordance with any instruction manual or technical guidelines provided by the Seller or supplied with the Goods, if applicable. The original end-user must give written notice to Seller of any suspected defect in the Goods prior to the expiration of the warranty period. The original end-user must also obtain a RGA from Seller prior to returning any Goods to Seller for warranty service under this paragraph. Seller will not accept any responsibility for Goods returned without a RGA. The original end-user shall be responsible for all costs and expenses associated with returning the Goods to Seller for warranty service. In the event of a defect, Seller, at its sole option, shall repair or replace the defective Goods or refund to the original end-user the purchase price for such defective Goods. Goods are not eligible for replacement or return after a period of 10 days from date of receipt. The foregoing warranty is Seller's sole obligation, and the original end-user's exclusive remedy, with regard to any defective Goods. This limited warranty does not apply to: (a) die sets, tooling, and saw blades; (b) periodic or routine maintenance and setup, (c) repair or replacement of the Goods due to normal wear and tear, (d) defects or damage to the Goods resulting from misuse, abuse, neglect, or accidents, (f) defects or damage to the Goods resulting from improper or unauthorized alterations, modifications, or changes; and (f) any Goods that has not been installed and/or maintained in accordance with the instruction manual or technical guidelines provided by Seller.

EXCLUSION OF OTHER WARRANTIES. THE FOREGOING LIMITED WARRANTY IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED. ANY AND ALL OTHER EXPRESS, STATUTORY OR IMPLIED WARRANTIES, INCLUDING BUT NOT LIMITED TO, ANY WARRANTY OF MERCHANTABILITY OR FITNESS FOR ANY PARTICULAR PURPOSE ARE EXPRESSLY DISCLAIMED. NO WARRANTY IS MADE WHICH EXTENDS BEYOND THAT WHICH IS EXPRESSLY CONTAINED HEREIN.

Limitation of Liability. IN NO EVENT SHALL SELLER BE LIABLE TO BUYER OR ANY OTHER PARTY FOR ANY INCIDENTIAL, CONSEQUENTIAL OR SPECIAL DAMAGES (INCLUDING, WITHOUT LIMITATION, LOST PROFITS OR DOWN TIME) ARISING FROM OR IN MANNER CONNECTED WITH THE GOODS, ANY BREACH BY SELLER OR ITS AGENTS OF THIS AGREEMENT, OR ANY OTHER CAUSE WHATSOEVER, WHETHER BASED ON CONTRACT, TORT OR ANY OTHER THEORY OF LIABILITY. BUYER'S REMEDY WITH RESPECT TO ANY CLAIM ARISING UNDER THIS AGREEMENT IS STRICTLY LIMITED TO NO MORE THAN THE AMOUNT PAID BY THE BUYER FOR THE GOODS.



Force Majeure. Seller shall not be responsible for any delay in the delivery of, or failure to deliver, Goods due to causes beyond Seller's reasonable control including, without limitation, acts of God, acts of war or terrorism, enemy actions, hostilities, strikes, labor difficulties, embargoes, non-delivery or late delivery of materials, parts and equipment or transportation delays not caused by the fault of Seller, delays caused by civil authorities, governmental regulations or orders, fire, lightening, natural disasters or any other cause beyond Seller's reasonable control. In the event of any such delay, performance will be postponed by such length of time as may be reasonably necessary to compensate for the delay.

Installation. If Buyer purchases any Goods that require installation, Buyer shall, at its expense, make all arrangements and connections necessary to install and operate the Goods. Buyer shall install the Goods in accordance with any Seller instructions and shall indemnify Seller against any and all damages, demands, suits, causes of action, claims and expenses (including actual attorneys' fees and costs) arising directly or indirectly out of Buyer's failure to properly install the Goods.

Work By Others; Safety Devices. Unless agreed to in writing by Seller, Seller has no responsibility for labor or work performed by Buyer or others, of any nature, relating to design, manufacture, fabrication, use, installation or provision of Goods. Buyer is solely responsible for furnishing and requiring its employees and customers to use all safety devices, guards and safe operating procedures required by law and/or as set forth in manuals and instruction sheets furnished by Seller. Buyer is responsible for consulting all operator manuals, ANSI or comparable safety standards, OSHA regulations and other sources of safety standards and regulations applicable to the use and operation of the Goods.

Remedies. Each of the rights and remedies of Seller under this Agreement is cumulative and in addition to any other or further remedies provided under this Agreement or at law or equity.

Attorney's Fees. In the event legal action is necessary to recover monies due from Buyer or to enforce any provision of this Agreement, Buyer shall be liable to Seller for all costs and expenses associated therewith, including Seller's actual attorney fees and costs.

Governing Law/Venue. This Agreement shall be construed and governed under the laws of the State of Wisconsin, without application of conflict of law principles. Each party agrees that all actions or proceedings arising out of or in connection with this Agreement shall be commenced, tried, and litigated only in the state courts sitting in Manitowoc County, Wisconsin or the U.S. Federal Court for the Eastern District of Wisconsin. Each party waives any right it may have to assert the doctrine of "forum non conveniens" or to object to venue to the extent that any proceeding is brought in accordance with this section. Each party consents to and waives any objection to the exercise of personal jurisdiction over it by courts described in this section. Each party waives to the fullest extent permitted by applicable law the right to a trial by jury.

Summary of Return Policy.

- 10 Day acceptance period from date of delivery. Damage claims and order discrepancies will not be accepted after this time.
- You must obtain a Baileigh issued RGA number PRIOR to returning any materials.
- Returned materials must be received at Baileigh in new condition and in original packaging.
- Altered items are not eligible for return.
- Buyer is responsible for all shipping charges.
- A 30% re-stocking fee applies to all returns.

Baileigh Industrial Holdings LLC makes every effort to ensure that our posted specifications, images, pricing and product availability are as correct and timely as possible. We apologize for any discrepancies that may occur. Baileigh Industrial Holdings LLC reserves the right to make any and all changes deemed necessary in the course of business including but not limited to pricing, product specifications, quantities, and product availability.

For Customer Service & Technical Support:

Please contact one of our knowledgeable Sales and Service team members at: (920) 684-4990 or e-mail us at sales@baileigh.com



INTRODUCTION

The quality and reliability of the components assembled on a Baileigh Industrial Holdings LLC machine guarantee near perfect functioning, free from problems, even under the most demanding working conditions. However, if a situation arises, refer to the manual first. If a solution cannot be found, contact the distributor where you purchased our product. Make sure you have the serial number and production year of the machine (stamped on the nameplate). For replacement parts refer to the assembly numbers on the parts list drawings.

Our technical staff will do their best to help you get your machine back in working order.

In this manual you will find: (when applicable)

- Safety procedures
- Correct installation guidelines
- Description of the functional parts of the machine
- Capacity charts
- Setup and start-up instructions
- Machine operation
- Scheduled maintenance
- Parts lists

GENERAL NOTES

After receiving your equipment remove the protective container. Do a complete visual inspection, and if damage is noted, **photograph it for insurance claims** and contact your carrier at once, requesting inspection. Also contact Baileigh Industrial Holdings LLC and inform them of the unexpected occurrence. Temporarily suspend installation.

Take necessary precautions while loading / unloading or moving the machine to avoid any injuries.

Your machine is designed and manufactured to work smoothly and efficiently. Following proper maintenance instructions will help ensure this. Try and use original spare parts, whenever possible, and most importantly; **DO NOT** overload the machine or make any modifications.



Note: This symbol refers to useful information throughout the manual.





IMPORTANT PLEASE READ THIS OPERATORS MANUAL CAREFULLY

It contains important safety information, instructions, and necessary operating procedures. The continual observance of these procedures will help increase your production and extend the life of the equipment.

SAFETY INSTRUCTIONS

LEARN TO RECOGNIZE SAFETY INFORMATION

This is the safety alert symbol. When you see this symbol on your machine or in this manual, **BE ALERT TO THE POTENTIAL FOR PERSONAL INJURY!**



Follow recommended precautions and safe operating practices.

UNDERSTAND SIGNAL WORDS

A signal word – **DANGER**, **WARNING**, or **CAUTION** – is used with the safety alert symbol. **NOTICE**, which is not related to personal injury, is used without a symbol.

DANGER: Indicates a hazardous situation which, if not avoided, will result in death or serious injury.

WARNING: Indicates a hazardous situation which, if not avoided, could result in death or serious injury.

CAUTION: Indicates a hazardous situation which, if not avoided, could result in minor or moderate injury.

NOTICE: Indicates a situation which, if not avoided, could result in property damage.







NOTICE



SAVE THESE INSTRUCTIONS. Refer to them often and use them to instruct others.



PROTECT EYES

Wear safety glasses or suitable eye protection when working on or around machinery.





PROTECT AGAINST NOISE

Prolonged exposure to loud noise can cause impairment or loss of hearing. Wear suitable hearing protective devices such as ear muffs or earplugs to protect against objectionable or uncomfortable loud noises.





BEWARE OF PIERCING POINTS

NEVER place hands, fingers, or any part of your body near rotating tools. Hole saws are very sharp and can quickly pierce your fingers and hands. Always wear heavy leather gloves when handling these tools.







ENTANGLEMENT HAZARD – ROTATING SPINDLE

Contain long hair, **DO NOT** wear jewelry or loose fitting clothing.





SAFETY PRECAUTIONS



Metal working can be dangerous if safe and proper operating procedures are not followed. As with all machinery, there are certain hazards involved with the operation of the product. Using the machine with respect and caution will considerably lessen the possibility of personal injury. However, if normal safety precautions are overlooked or ignored, personal injury to the operator may result.

Safety equipment such as guards, hold-downs, safety glasses, dust masks and hearing protection can reduce your potential for injury. But even the best guard will not make up for poor judgment, carelessness or inattention. **Always use common sense** and exercise **caution** in the workshop. If a procedure feels dangerous, don't try it.

REMEMBER: Your personal safety is your responsibility.



WARNING: FAILURE TO FOLLOW THESE RULES MAY RESULT IN SERIOUS PERSONAL INJURY

Dear Valued Customer:

- All Baileigh machines should be used only for their intended use.
- Baileigh does not recommend or endorse making any modifications or alterations to a
 Baileigh machine. Modifications or alterations to a machine may pose a substantial risk of
 injury to the operator or others and may do substantial damage to the machine.
- Any modifications or alterations to a Baileigh machine will invalidate the machine's warranty.

PLEASE ENJOY YOUR BAILEIGH MACHINE!PLEASE ENJOY IT SAFELY!

- 1. FOR YOUR OWN SAFETY, READ INSTRUCTION MANUAL BEFORE OPERATING THE MACHINE. Learn the machine's application and limitations as well as the specific hazards.
- 2. Only trained and qualified personnel can operate this machine.
- 3. Make sure guards are in place and in proper working order before operating machinery.
- 4. **Remove any adjusting tools.** Before operating the machine, make sure any adjusting tools have been removed.
- 5. **Keep work area clean.** Cluttered areas invite injuries.
- 6. **Overloading machine.** By overloading the machine you may cause injury from flying parts. **DO NOT** exceed the specified machine capacities.
- 7. Dressing material edges. Always chamfer and deburr all sharp edges.



- 8. **Do not force tool.** Your machine will do a better and safer job if used as intended. **DO NOT** use inappropriate attachments in an attempt to exceed the machines rated capacity.
- Use the right tool for the job. DO NOT attempt to force a small tool or attachment to do the
 work of a large industrial tool. DO NOT use a tool for a purpose for which it was not
 intended.
- 10. **Dress appropriate. DO NOT** wear loose fitting clothing or jewelry as they can be caught in moving machine parts. Protective clothing and steel toe shoes are recommended when using machinery. Wear a restrictive hair covering to contain long hair.
- 11. **Use eye and ear protection**. Always wear ISO approved impact safety goggles. Wear a full-face shield if you are producing metal filings.
- 12. **Do not overreach**. Maintain proper footing and balance at all times. **DO NOT** reach over or across a running machine.
- 13. **Stay alert**. Watch what you are doing and use common sense. **DO NOT** operate any tool or machine when you are tired.
- 14. Check for damaged parts. Before using any tool or machine, carefully check any part that appears damaged. Check for alignment and binding of moving parts that may affect proper machine operation.
- 15. Observe work area conditions. DO NOT use machines or power tools in damp or wet locations. Do not expose to rain. Keep work area well lighted. DO NOT use electrically powered tools in the presence of flammable gases or liquids.
- 16. **Blade adjustments and maintenance**. Always keep blades sharp and properly adjusted for optimum performance.
- 17. **Keep children away**. Children must never be allowed in the work area. **DO NOT** let them handle machines, tools, or extension cords.
- 18. **Store idle equipment**. When not in use, tools must be stored in a dry location to inhibit rust. Always lock up tools and keep them out of reach of children.
- 19. **DO NOT operate machine if under the influence of alcohol or drugs**. Read warning labels on prescriptions. If there is any doubt, **DO NOT** operate the machine.
- 20. DO NOT touch live electrical components or parts.
- 21. **Turn off** power before checking, cleaning, or replacing any parts.
- 22. Be sure **all** equipment is properly installed and grounded according to national, state, and local codes.
- 23. Inspect power and control cables periodically. Replace if damaged or bare wires are exposed. **Bare wiring can kill!**
- 24. **DO NOT** bypass or defeat any safety interlock systems.
- 25. Keep visitors a safe distance from the work area.



TECHNICAL SPECIFICATIONS

Notching Capacity (OD)	5/8" - 3" (15.8 – 76.2mm)
Angle Adjustment	0 – 90°
Spindle Speed	233rpm
Power	110V / 60hz
Motor	1/2HP (.4kw) / 9A
Shipping Weight	265 lbs. (120kg)
Shipping Dimensions	48" x 31" x 31" (1220 x 788 x 788mm)

TECHNICAL SUPPORT

Our technical support department can be reached at 920.684.4990 and asking for the support desk for purchased machines. Tech Support handles questions on machine setup, schematics, warranty issues, and individual parts needs: (other than die sets and blades).

For specific application needs or future machine purchases contact the Sales Department at: sales@baileigh.com, Phone: 920.684.4990, or Fax: 920.684.3944.

Note: The photos and illustrations used in this manual are representative only and may not depict the actual color, labeling or accessories and may be intended to illustrate technique only.

Note: The specifications and dimensions presented here are subject to change without prior notice due to improvements of our products.



UNPACKING AND CHECKING CONTENTS

Your Baileigh machine is shipped complete. Separate all parts from the packing material and check each item carefully. Make certain all items are accounted for before discarding any packing material.

WARNING: SUFFOCATION HAZARD! Immediately discard any plastic bags and packing materials to eliminate choking and suffocation hazards to children and animals.

If any parts are missing, DO NOT place the machine into service until the missing parts are obtained and installed correctly.

Cleaning

WARNING: DO NOT USE gasoline or other petroleum products to clean the machine. They have low flash points and can explode or cause fire.

CAUTION: When using cleaning solvents work in a well-ventilated area. Many cleaning solvents are toxic if inhaled.

Your machine may be shipped with a rustproof waxy coating and/or grease on the exposed unpainted metal surfaces. Fully and completely remove this protective coating using a degreaser or solvent cleaner. Moving items will need to be moved along their travel path to allow for cleaning the entire surface. For a more thorough cleaning, some parts will occasionally have to be removed. **DO NOT USE** acetone or brake cleaner as they may damage painted surfaces.

Follow manufacturer's label instructions when using any type of cleaning product. After cleaning, wipe unpainted metal surfaces with a light coating of quality oil or grease for protection.

Important: This waxy coating is **NOT** a lubricant and will cause the machine to stick and lose performance as the coating continues to dry.









TRANSPORTING AND LIFTING

NOTICE: Lifting and carrying operations should be carried out by skilled workers, such as a truck operator, crane operator, etc. If a crane is used to lift the machine, attach the lifting chain carefully, making sure the machine is well balanced.

Follow these guidelines when lifting with truck or trolley:

- The lift truck must be able to lift at least 1.5 − 2 times the machines gross weight.
- Make sure the machine is balanced. While transporting, avoid rough or jerky motion, and maintain a safe clearance zone around the transport area.
- Use a forklift with sufficient lifting capacity and forks that are long enough to reach the complete width of the machine.



- Remove the securing bolts that attach the machine to the pallet.
- Approaching the machine from the side, lift the machine on the frame taking care that there
 are no cables or pipes in the area of the forks.
- Move the machine to the required position and lower gently to the floor.
- Level the machine so that all the supporting feet are taking the weight of the machine and no rocking is taking place.

Follow these guidelines when lifting crane or hoist:

- Always lift and carry the machine with the lifting holes provided at the top of the machine.
- Use lift equipment such as straps, chains, capable of lifting 1.5 to 2 times the weight of the machine.
- Take proper precautions for handling and lifting.
- Check if the load is properly balanced by lifting it an inch or two.
- Lift the machine, avoiding sudden accelerations or quick changes of direction.
- Locate the machine where it is to be installed, then lower slowly until it touches the floor.



INSTALLATION

IMPORTANT:

Consider the following when looking for a suitable location to place the machine:

- · Overall weight of the machine.
- Weight of material being processed.
- Sizes of material to be processed through the machine.
- Space needed for auxiliary stands, worktables, or other machinery.
- Clearance from walls and other obstacles.
- Maintain an adequate working area around the machine for safety.
- Have the work area well illuminated with proper lighting.
- Keep the floor free of oil and make sure it is not slippery.
- Remove scrap and waste materials regularly, and make sure the work area is free from obstructing objects.
- If long lengths of material are to be fed into the machine, make sure that they will not extend into any aisles.
- **LEVELING:** The machine should be sited on a level, concrete floor. Provisions for securing it should be in position prior to placing the machine. The accuracy of any machine depends on the precise placement of it to the mounting surface.
- **FLOOR:** This machine distributes a large amount of weight over a small area. Make certain that the floor is capable of supporting the weight of the machine, work stock, and the operator. The floor should also be a level surface. If the unit wobbles or rocks once in place, be sure to eliminate by using shims.
- WORKING CLEARANCES: Take into consideration the size of the material to be processed. Make sure that you allow enough space for you to operate the machine freely.
- **POWER SUPPLY PLACEMENT:** The power supply should be located close enough to the machine so that the power cord is not in an area where it would cause a tripping hazard. Be sure to observe all electrical codes if installing new circuits and/or outlets.


Anchoring the Machine


This machine is generally mounted on a bench top. If you intend to mount this machine on a workbench be aware of the following:


- Make sure the workbench is properly reinforced to support the weight.
- The strongest mounting option is where the holes are drilled all the way through the workbench and the machine is secured with bolts, washers, and nuts.




OVERALL DIMENSIONS

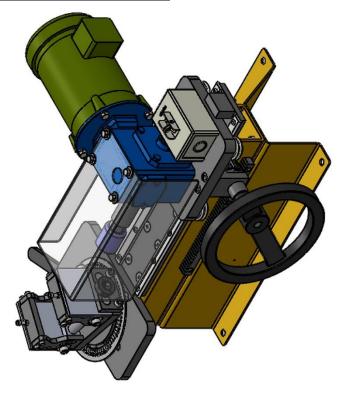

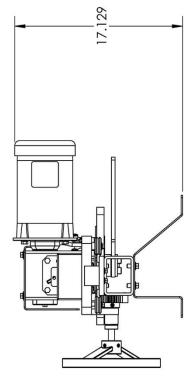

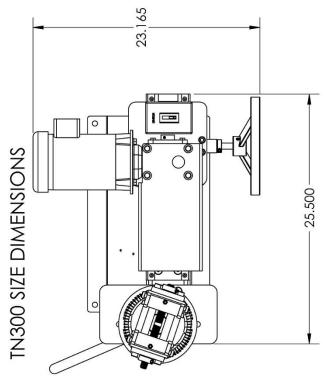

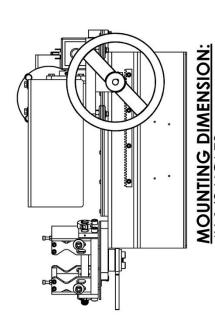



ELECTRICAL

CAUTION: HAVE ELECTRICAL UTILITIES CONNECTED TO MACHINE BY A CERTIFIED ELECTRICIAN!

Check if the available power supply is the same as listed on the machine nameplate.

WARNING: Make sure the grounding wire (green) is properly connected to avoid electric shock. DO NOT switch the position of the green grounding wire if any electrical plug wires are switched during hookup.

Power Specifications

Your machine is wired for 110 volts, 60hz alternating current. Before connecting the machine to the power source, make sure the power source is OFF.

Before switching on the power, you must check the voltage and frequency of the power to see if they meet with the requirement, the allowed range for the voltage is $\pm 5\%$, and for the frequency is $\pm 1\%$.

Considerations

- Observe local electrical codes when connecting the machine.
- The circuit should be protected with a time delay fuse or circuit breaker with an amperage rating slightly higher than the full load current of machine.
- A separate electrical circuit should be used for your machines. Before connecting the motor to the power line, make sure the switch is in the "OFF" position and be sure that the electric current is of the same characteristics as indicated on the machine.
- All line connections should make good contact. Running on low voltage will damage the motor.
- In the event of a malfunction or breakdown, grounding provides a path of least resistance for electric current to reduce the risk of electric shock. This machine is equipped with an electric cord having an equipment-grounding conductor and a grounding plug. The plug must be plugged into a matching outlet that is properly installed and grounded in accordance with all local codes and ordinances.

WARNING: In all cases, make certain the receptacle in question is properly grounded. If you are not sure, have a qualified electrician check the receptacle.



- Improper connection of the equipment-grounding conductor can result in risk of electric shock. The conductor with insulation having an outer surface that is green with or without yellow stripes is the equipment-grounding conductor. If repair or replacement of the electric cord or plug is necessary, do not connect the equipment-grounding conductor to a live terminal.
- Check with qualified electrician or service personnel if the grounding instructions are not completely understood, or if in doubt as to whether the machine is properly grounded.
- Repair or replace damaged or worn cord immediately.

Extension Cord Safety

Extension cord should be in good condition and meet the minimum wire gauge requirements listed below:

		LENGTH	
AMP RATING	25ft	50ft	100ft
1-12	16	16	14
13-16	14	12	12
17-20	12	12	10
21-30	10	10	No
	WIRE GAUGE		

An undersized cord decreases line voltage, causing loss of power and overheating. All cords should use a ground wire and plug pin. Replace any damaged cords immediately.



OPERATION

CAUTION: Always wear proper eye protection with side shields, safety footwear, and leather gloves to protect from burrs and sharp edges. When handling large heavy materials make sure they are properly supported.

This notcher uses replaceable hole-saws to produce quality notches in various materials at almost unlimited angles.

1. Before notching can take place, the correct hole-saw must be selected to match the material being notched.

Note: Only heavy duty hole saws can be used. The hole-saws with solid backing plates are best. The stamped and formed hole-saws are not rigid enough for this machine. The hole-saws simply screw onto the arbor.

2. Loosen the vise lock lever and rotate to the desired notch angle and re-tighten.



 
3. Select the material and insert it into the vise. Leave the minimum required material hanging beyond the vise.







- 4. Start the notcher with the on/off switch.
- Grasp the feed hand wheel and SLOWLY feed the hole-saw into the tubing. Continue feeding completely through the material to complete the notch.
- 6. The speed of the hole-saw is fixed and is correct for most sizes.
- 7. If you encounter chatter, feed slower and make sure the "V" rollers have enough tension on them. The feed hand wheel should have a slight resistance set by the "V" rollers; if the rollers should loosen up they will need to be adjusted to describe the should loosen up they will need to be adjusted to describe the solution.





Arbor Adapters

When setting up the notcher, use the correct arbor to saw adapter to fit the size and manufacturer of the hole saw being used.

Contact the Baileigh Industrial to order optional or replacement adapters.



Hole Saw End

Arbor End

Standard Adapter.
Used with most hole saws.

Reducer Adapter. Used with small hole saws. Optional Adapter. Larger M18 end to fit certain hole saws manufacturer saws.



MACHINE ADJUSTMENTS

Two of the rollers have an eccentric tension adjuster, they are the ones that have a hexed shaped portion beneath the "V" roller.

- 1. To adjust, loosen the center bolt using a 1/2" wrench, and then with another wrench to hold the hex, rotate the hex slightly and the roller will either tighten or loosen as the hex eccentric is turned.
- 2. Give it a little tension and tighten the center screw, try the feed handwheel and check the resistance. The rollers should NOT be able to rotate by hand, that would be too loose.



LUBRICATION AND MAINTENANCE

WARNING: Make sure the electrical disconnect is <u>OFF</u> before working on e machine.

Maintenance should be performed on a regular basis by qualified personnel. Always follow proper safety precautions when working on or around any machinery.

- Check daily for any unsafe conditions and fix immediately.
- Check that all nuts and bolts are properly tightened.
- On a weekly basis clean the machine and the area around it.
- Lubricate threaded components and sliding devices.
- Apply rust inhibitive lubricant to all non-painted surfaces.




Note: Proper maintenance can increase the life expectancy of your machine.




PARTS DIAGRAM


Handwheel Assembly Parts Diagram

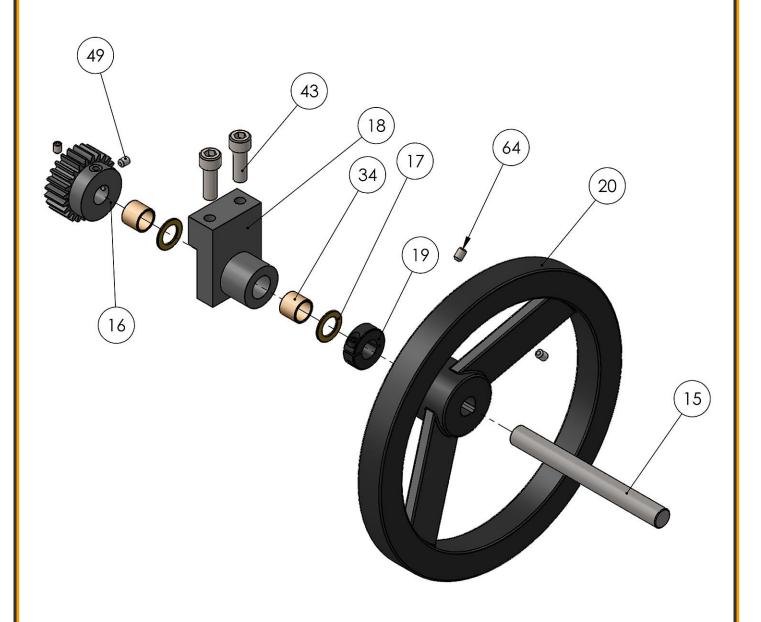




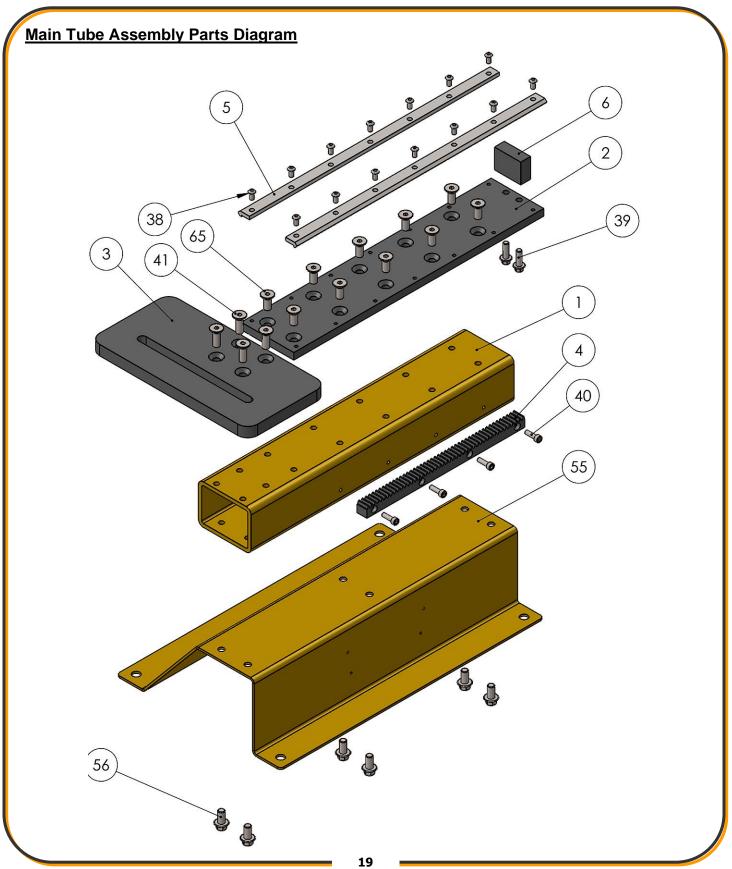




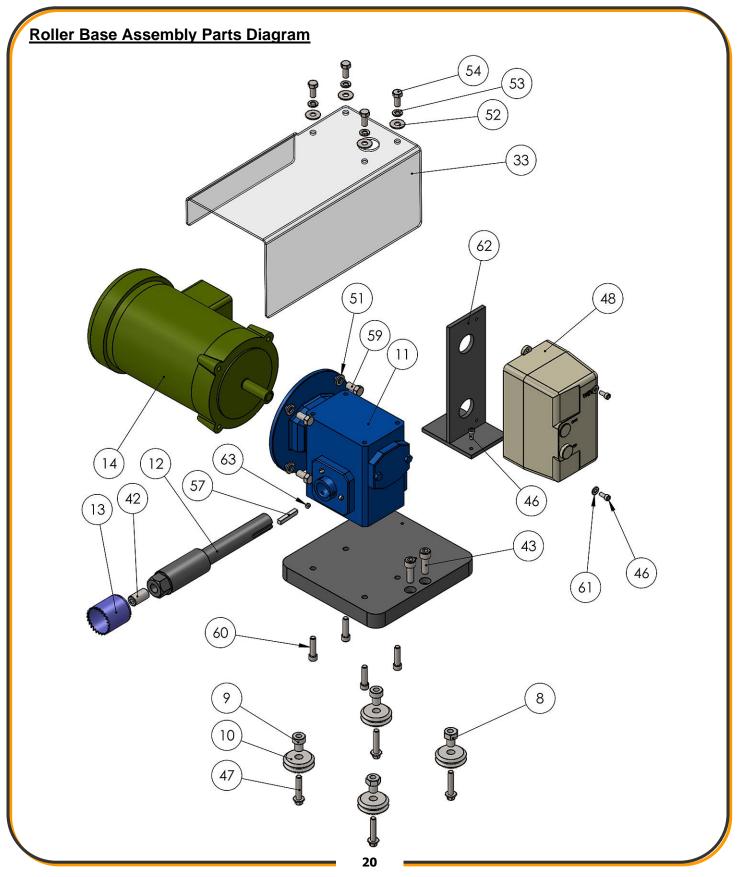



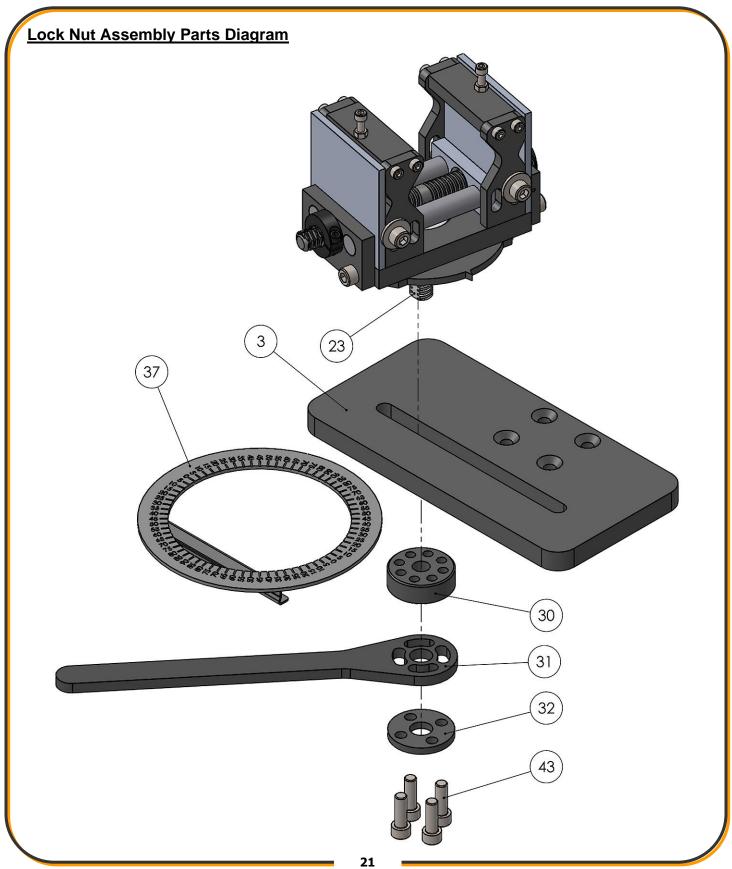




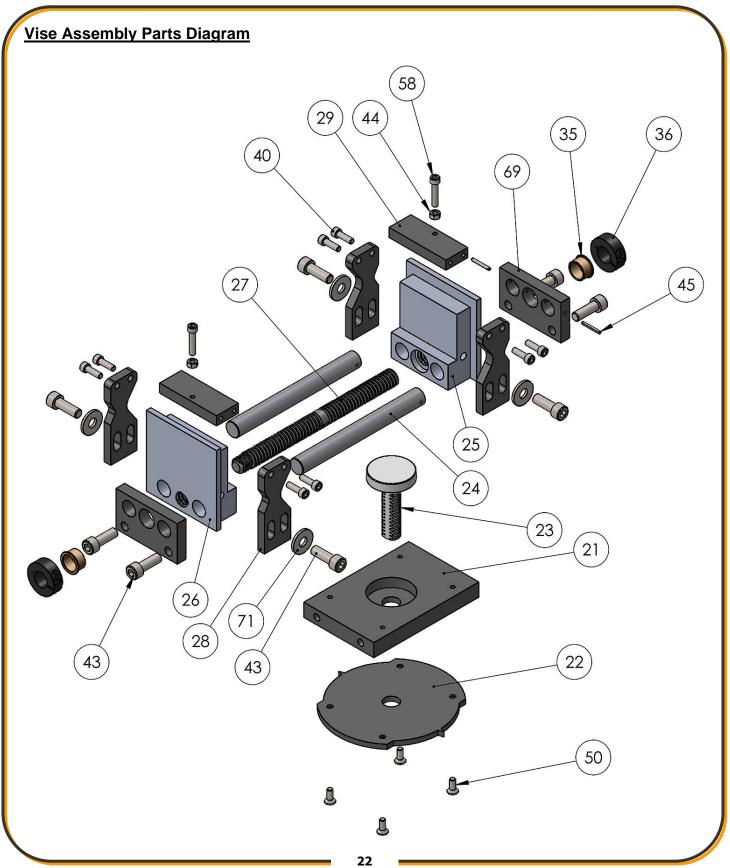



Electrical Box Assembly Parts Diagram

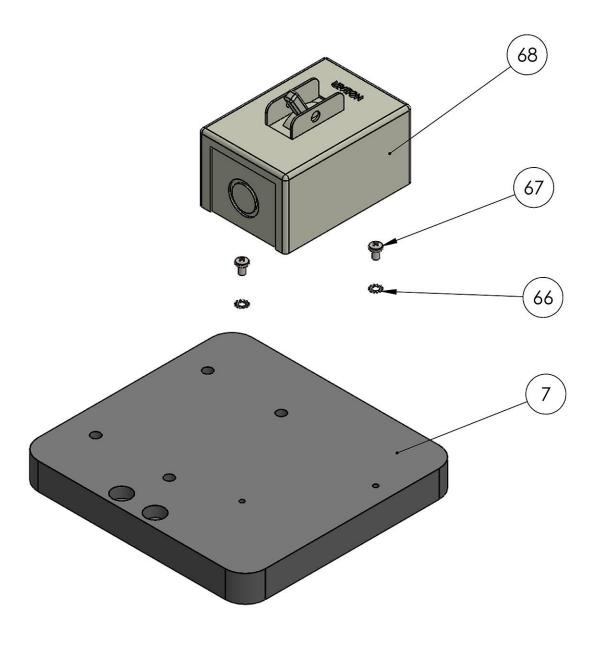



Parts List

Item	Part Number	Description	Qty.
1	ME-M600-6A001	Main Tube	1
2	ME-M600-6A003	Track Mount	1
3	ME-M600-6A005	Slide Plate	1
4	ME-M600-6A009	Gear Rack	1
5	M600-6A026	Vee Track 19"	2
6	ME-M600-6A017	Stop Block	1
7	ME-M600-6A004	Slide Plate	1
8	PP-0202-ME	Adjusting Bushing Wx3	2
9	PP-0203-ME	Non-Adjusting Bushing W3	2
10	PP-0201	V-Roller	4
11	PP-0962	Gearbox	1
12	ME-M600-7A001	Saw Arbor	1
13	PP-0971	1.75 Holesaw	1
14	PP-1074	1/2hp 1 Phase Motor	1
15	M600-7A003	Axle Shaft	1
16	ME-M600-7A004	24 Tooth Gear	1
17	PP-0168	.625 ID x 1.0 OD x .0625	2
18	ME-M600-6A006	Shaft Mount	1
19	PP-0958	5/8" Clamp Collar	1
20	PP-1031	10" Handwheel	1
21	ME-M900-6A047	Vise Base	1
22	ME-M900-6A052	Pointer Disc	1
23	M900-7A011	Vise Lock Stud	1
24	M900-7A014	Vise Slide Shaft	2
25	ME-M900-6A055	Vise Slide Block (L.H.)	1
26	ME-M900-6A049	Vise Slide Block (R.H.)	1
27	M900-7A012	Double Vise Screw	1
28	M900-6A050	Vise Jaw	4
29	ME-M900-6A051	Vise Cross Bar	2
30	ME-M900-6A042	Vise Lock Nut	1
31	M900-6A040	Lock Lever	1
32	M900-6A041	Lock Cap	1
33	M600-6A008	Lexan Guard	1




34 PP-0997 3/4 OD x 5/8 ID x 5/8 Lg Bush 2 35 PP-1063 .75 ID x .875 OD x .5 Flange Bushing 2 36 PP-0090 3/4" Split Collar 2 37 M600-5A002 Degree Dial 1 38 BSM-0138 M6 x 1.0 x 12 BHCS 14 39 BSM-0053 M8 x 1.25 x 25 Hex Flg 2 40 BSM-0002 M6 x 1.0 x 20 SHCS 12 41 BSM-0002 M6 x 1.0 x 20 SHCS 12 41 BSM-0139 M10 x 1.5 x 30 FHCS 4 42 BS-0261 5/8-18 x 1.25 Set Screw 1 43 BSM-0016 M10 x 1.5 x 30 SHCS 2 44 BSM-0182 M6 x 1.0 Hex Nut 2 45 BS-0088 1/8 x 1 Slotted Spring Pin 2 46 BSM-0115 M5 x 0.8 x 12 SHCS 4 47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 3 Set S	Item	Part Number	Description	Qty.
35 PP-1063 .75 ID x .875 OD x .5 Flange Bushing 2 36 PP-0090 3/4" Split Collar 2 37 M600-5A002 Degree Dial 1 38 BSM-0138 M6 x 1.0 x 12 BHCS 14 39 BSM-0053 M8 x 1.25 x 25 Hex Flg 2 40 BSM-0002 M6 x 1.0 x 20 SHCS 12 41 BSM-0139 M10 x 1.5 x 30 FHCS 4 42 BS-0261 5/8-18 x 1.25 Set Screw 1 43 BSM-0166 M10 x 1.5 x 30 SHCS 2 44 BSM-016 M10 x 1.5 x 30 SHCS 2 44 BSM-0182 M6 x 1.0 Hex Nut 2 45 BS-088 1/8 x 1 Slotted Spring Pin 2 45 BS-0088 1/8 x 1 Slotted Spring Pin 2 46 BSM-0115 M5 x 0.8 x 12 SHCS 4 47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 16 FHCS	34	PP-0997		
36 PP-0090 3/4" Split Collar 2 37 M600-5A002 Degree Dial 1 38 BSM-0138 M6 x 1.0 x 12 BHCS 14 39 BSM-0053 M8 x 1.25 x 25 Hex Flg 2 40 BSM-0002 M6 x 1.0 x 20 SHCS 12 41 BSM-0139 M10 x 1.5 x 30 FHCS 4 42 BS-0261 5/8-18 x 1.25 Set Screw 1 43 BSM-0016 M10 x 1.5 x 30 SHCS 2 44 BSM-0182 M6 x 1.0 Hex Nut 2 45 BS-088 1/8 x 1 Slotted Spring Pin 2 46 BSM-0115 M5 x 0.8 x 12 SHCS 4 47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0122 M6 x 1.0 x 16 FHCS 4 51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 <td>35</td> <td></td> <td></td> <td>2</td>	35			2
37 M600-5A002 Degree Dial 1 38 BSM-0138 M6 x 1.0 x 12 BHCS 14 39 BSM-0053 M8 x 1.25 x 25 Hex Flg 2 40 BSM-0002 M6 x 1.0 x 20 SHCS 12 41 BSM-0139 M10 x 1.5 x 30 FHCS 4 42 BS-0261 5/8-18 x 1.25 Set Screw 1 43 BSM-0016 M10 x 1.5 x 30 SHCS 2 44 BSM-0182 M6 x 1.0 Hex Nut 2 45 BS-0088 1/8 x 1 Slotted Spring Pin 2 45 BS-0088 1/8 x 1 Slotted Spring Pin 2 46 BSM-0182 M6 x 1.0 Hex Nut 2 45 BS-0088 1/8 x 1 Slotted Spring Pin 2 46 BSM-0182 M8 x 1.25 x 40 Hex Flg 4 47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0122 M6 x 1.0 x 36 Set Screw<	36	PP-0090		2
39 BSM-0053 M8 x 1.25 x 25 Hex Flg 2 40 BSM-0002 M6 x 1.0 x 20 SHCS 12 41 BSM-0139 M10 x 1.5 x 30 FHCS 4 42 BS-0261 5/8-18 x 1.25 Set Screw 1 43 BSM-0016 M10 x 1.5 x 30 SHCS 2 44 BSM-0182 M6 x 1.0 Hex Nut 2 45 BS-0088 1/8 x 1 Slotted Spring Pin 2 46 BSM-0115 M5 x 0.8 x 12 SHCS 4 47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0122 M6 x 1.0 x 16 FHCS 4 51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 <td>37</td> <td>M600-5A002</td> <td><u> </u></td> <td>1</td>	37	M600-5A002	<u> </u>	1
40 BSM-0002 M6 x 1.0 x 20 SHCS 12 41 BSM-0139 M10 x 1.5 x 30 FHCS 4 42 BS-0261 5/8-18 x 1.25 Set Screw 1 43 BSM-0016 M10 x 1.5 x 30 SHCS 2 44 BSM-0182 M6 x 1.0 Hex Nut 2 45 BS-0088 1/8 x 1 Slotted Spring Pin 2 46 BSM-0115 M5 x 0.8 x 12 SHCS 4 47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0122 M6 x 1.0 x 16 FHCS 4 49 BS-0074 3/8 Lock Washer 4 51 BS-0082 5/16 Flat Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1	38	BSM-0138	M6 x 1.0 x 12 BHCS	14
41 BSM-0139 M10 x 1.5 x 30 FHCS 4 42 BS-0261 5/8-18 x 1.25 Set Screw 1 43 BSM-0016 M10 x 1.5 x 30 SHCS 2 44 BSM-0182 M6 x 1.0 Hex Nut 2 45 BS-0088 1/8 x 1 Slotted Spring Pin 2 46 BSM-0115 M5 x 0.8 x 12 SHCS 4 47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0122 M6 x 1.0 x 16 FHCS 4 49 BS-0074 3/8 Lock Washer 4 51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1	39	BSM-0053	M8 x 1.25 x 25 Hex Flg	2
42 BS-0261 5/8-18 x 1.25 Set Screw 1 43 BSM-0016 M10 x 1.5 x 30 SHCS 2 44 BSM-0182 M6 x 1.0 Hex Nut 2 45 BS-0088 1/8 x 1 Slotted Spring Pin 2 46 BSM-0115 M5 x 0.8 x 12 SHCS 4 47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0122 M6 x 1.0 x 16 FHCS 4 51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 <	40	BSM-0002	M6 x 1.0 x 20 SHCS	12
43 BSM-0016 M10 x 1.5 x 30 SHCS 2 44 BSM-0182 M6 x 1.0 Hex Nut 2 45 BS-0088 1/8 x 1 Slotted Spring Pin 2 46 BSM-0115 M5 x 0.8 x 12 SHCS 4 47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0084 M6 x 1.0 x 16 FHCS 4 51 BS-0074 3/8 Lock Washer 4 51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2	41	BSM-0139	M10 x 1.5 x 30 FHCS	4
44 BSM-0182 M6 x 1.0 Hex Nut 2 45 BS-0088 1/8 x 1 Slotted Spring Pin 2 46 BSM-0115 M5 x 0.8 x 12 SHCS 4 47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0122 M6 x 1.0 x 16 FHCS 4 51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0771 5/16-18 x 1.25 SHCS 4	42	BS-0261	5/8-18 x 1.25 Set Screw	1
45 BS-0088 1/8 x 1 Slotted Spring Pin 2 46 BSM-0115 M5 x 0.8 x 12 SHCS 4 47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0122 M6 x 1.0 x 16 FHCS 4 51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2	43	BSM-0016	M10 x 1.5 x 30 SHCS	2
46 BSM-0115 M5 x 0.8 x 12 SHCS 4 47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0122 M6 x 1.0 x 16 FHCS 4 51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 <t< td=""><td>44</td><td>BSM-0182</td><td>M6 x 1.0 Hex Nut</td><td>2</td></t<>	44	BSM-0182	M6 x 1.0 Hex Nut	2
47 BSM-0054 M8 x 1.25 x 40 Hex Flg 4 48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0122 M6 x 1.0 x 16 FHCS 4 51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6	45	BS-0088	1/8 x 1 Slotted Spring Pin	2
48 PP-1295 CE On/Off Switch 1 49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0122 M6 x 1.0 x 16 FHCS 4 51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2	46	BSM-0115	M5 x 0.8 x 12 SHCS	4
49 BSM-0084 M6 x 1.0 x 8 Set Screw 2 50 BSM-0122 M6 x 1.0 x 16 FHCS 4 51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 6 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 <td>47</td> <td>BSM-0054</td> <td>M8 x 1.25 x 40 Hex Flg</td> <td>4</td>	47	BSM-0054	M8 x 1.25 x 40 Hex Flg	4
50 BSM-0122 M6 x 1.0 x 16 FHCS 4 51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 <	48	PP-1295	CE On/Off Switch	1
51 BS-0074 3/8 Lock Washer 4 52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	49	BSM-0084	M6 x 1.0 x 8 Set Screw	2
52 BS-0082 5/16 Flat Washer 4 53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	50	BSM-0122	M6 x 1.0 x 16 FHCS	4
53 BS-0073 5/16 Lock Washer 4 54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	51	BS-0074	3/8 Lock Washer	4
54 BS-0039 5/16-18 x 3/4 HHCS 4 55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	52	BS-0082	5/16 Flat Washer	4
55 M600-6A007 Machine Stand 1 56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	53	BS-0073	5/16 Lock Washer	4
56 BSM-0058 M10 x 1.5 x 20 Hex Flg 6 57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	54	BS-0039	5/16-18 x 3/4 HHCS	4
57 M600-6A027 .25 x .25 x 1.50 Key 1 58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	55	M600-6A007	Machine Stand	1
58 BSM-0004 M6 x 1.0 x 30 SHCS 2 59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	56	BSM-0058	M10 x 1.5 x 20 Hex Flg	6
59 BS-0114 .375-16 x .75 HHCS 4 60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	57	M600-6A027	.25 x .25 x 1.50 Key	1
60 BS-0171 5/16-18 x 1.25 SHCS 4 61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	58	BSM-0004	M6 x 1.0 x 30 SHCS	2
61 BS-0079 #10 Flat Washer 2 62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	59	BS-0114	.375-16 x .75 HHCS	4
62 M600-5A003 Switch Weldment (CE) 1 63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	60	BS-0171	5/16-18 x 1.25 SHCS	4
63 BSM-0340 1/4-28 x .25 Set Screw 6 64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	61	BS-0079	#10 Flat Washer	2
64 BS-0063 1/4-20 x .375 Set Screw 2 65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	62	M600-5A003	Switch Weldment (CE)	1
65 BSM-0133 M10 x 1.5 x 25 FHCS 10 66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	63	BSM-0340	1/4-28 x .25 Set Screw	6
66 BSM-0197 M5 Star Washer 2 67 BSM-0205 M5 x .8 x 8 PPMS 2	64	BS-0063	1/4-20 x .375 Set Screw	2
67 BSM-0205 M5 x .8 x 8 PPMS 2	65	BSM-0133	M10 x 1.5 x 25 FHCS	10
	66	BSM-0197	M5 Star Washer	2
68 PP-0152 On/Off Switch (US) 1	67	BSM-0205	M5 x .8 x 8 PPMS	2
	68	PP-0152	On/Off Switch (US)	1



Item	Part Number	Description	Qty.
69	M900-6A048	Vise Shaft Support	1
70	M900-6A075	Vise Shaft Support	1
71	BSM-0089	M10 Flat Washer	4



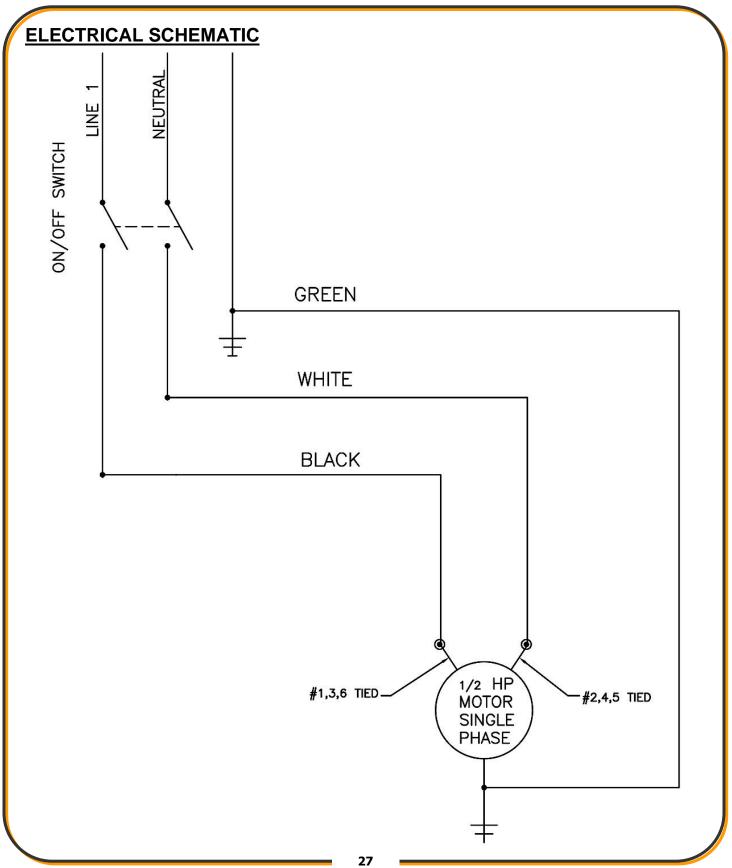



NOTES



NOTES



BAILEIGH INDUSTRIAL HOLDINGS LLC 1625 DUFEK DRIVE MANITOWOC, WI 54220 PHONE: 920. 684. 4990 FAX: 920. 684. 3944 www.baileigh.com

BAILEIGH INDUSTRIAL HOLDINGS LTD. UNIT D SWIFT POINT

SWIFT VALLEY INDUSTRIAL ESTATE, RUGBY
WEST MIDLANDS, CV21 1QH UNITED KINGDOM
PHONE: +44 (0)24 7661 9267 Fax: +44 (0)24 7661 9276

WWW.BAILEIGH.CO.UK